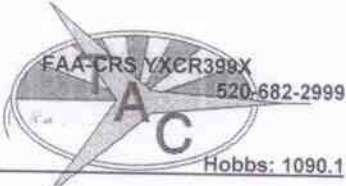



DATE	TOTAL TIME IN SERVICE	TACH CR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
TOTAL brought forward from previous page			
N4812E Cessna 182R Continental O-470-U18 McCauley C2A34C204C Actt: 11636.8	S/N 18268274 S/N 827714-R S/N 030738	TSMOH:1680.00 TSN: 2182.9 TSOH: 99.9 Tach: 690.2	
Complied with an Annual Inspection per the Cessna 182 Maintenance Manual, Customer provided information and FAR, Part 43, Appendix D.			
Complied with the following AD's: 2011-10-09 Seat and Seat Track Inspection. Next due: TT: 11786.8			
Complied with the following SB's: 95-2 Engine Control Inspection 96-12 Cylinder Inspection 96-2 Seatbelt and Harness Inspection 94-8D Magneto Inspection 90-17 Crankcase Inspection 99-18R1 fuel qty indicator inspection			
Complied with the following ICA's: Alternator Robertson STOL kit			
Complied with FAR91.207 (d) ELT Check. ELT battery due March 2016. Complied with Fuel Gauge Accuracy check Replaced vacuum regulator filter P/N B3-5-1. Complied with Magnetic compass swing. Complied with vacuum pump wear indicator inspection. Replaced engine air filter BA-8103.			
Installed 4 rivets to secure ELT antenna doubler to acft skin. Replaced GE 1692 bulb in pilots overhead light. Replaced instrument air filters P/N D9-18-1. All work performed IAW applicable maintenance manuals and current Federal Aviation Regulations. I certify that the aircraft and/or component identified above has received an Annual Inspection in accordance with FAR, Part 43, Appendix D and was determined to be in airworthy condition and is approved for return to service. Pertinent details are on file with Tucson Aeroservice Center. W.O. MA-12-3780 Work performed by C Hultman, D Davis, H Huggins, J Berens and John Mills.			
Date: <u>October 26, 2012</u>			Signed:  Ronald Anders jr FAA-CRS YXCR399X
SUB-TOTAL this page			
TOTAL—Carry forward to next page			